



# SERVICE No. 246 BULLETIN

Piper Aircraft Corporation

Lock Haven, Pennsylvania, U.S.A.

"FAA DOA EA-1 Approved"

March 21, 1967

---

Subject: Modification of Oxygen Cylinder Rear Retaining Strap  
Piper Part Number 758 109

Models Affected: PA-30 Twin Comanches (NOTE: Applicable only to  
aircraft that have had an oxygen system installed at  
the factory or aircraft that have had Piper Oxygen  
Installation Kit 757 100 installed.)

Serial Numbers Affected: 30-853, 30-902 to 30-1470 incl. (See note above)

Compliance Date: Prior to but not later than next 25 hours of operation

Reason For Bulletin: Modification of the oxygen cylinder rear retaining strap  
part number 758 109 to preclude the possibility of the  
strap rubbing the rudder control cable.

Material Required: None

Modification Instructions: See sketch on reverse side of this bulletin.

Warranty Labor Allowed: None

#### NOTE


All Oxygen Cylinder Rear Retaining Straps, part number 758 109,  
contained in Oxygen Cylinder Mounting Modification Kits, part  
number 757 094, (Reference Service Bulletin No. 236) in distributor  
or dealer stock must also be modified per this bulletin.

(over)

---

**NOTE**

**CUT RETAINING STRAP HERE (TOP AND BOTTOM). REMOVE REAR PORTION OF STRAP AND RUBBER STRIP. 13945-85**

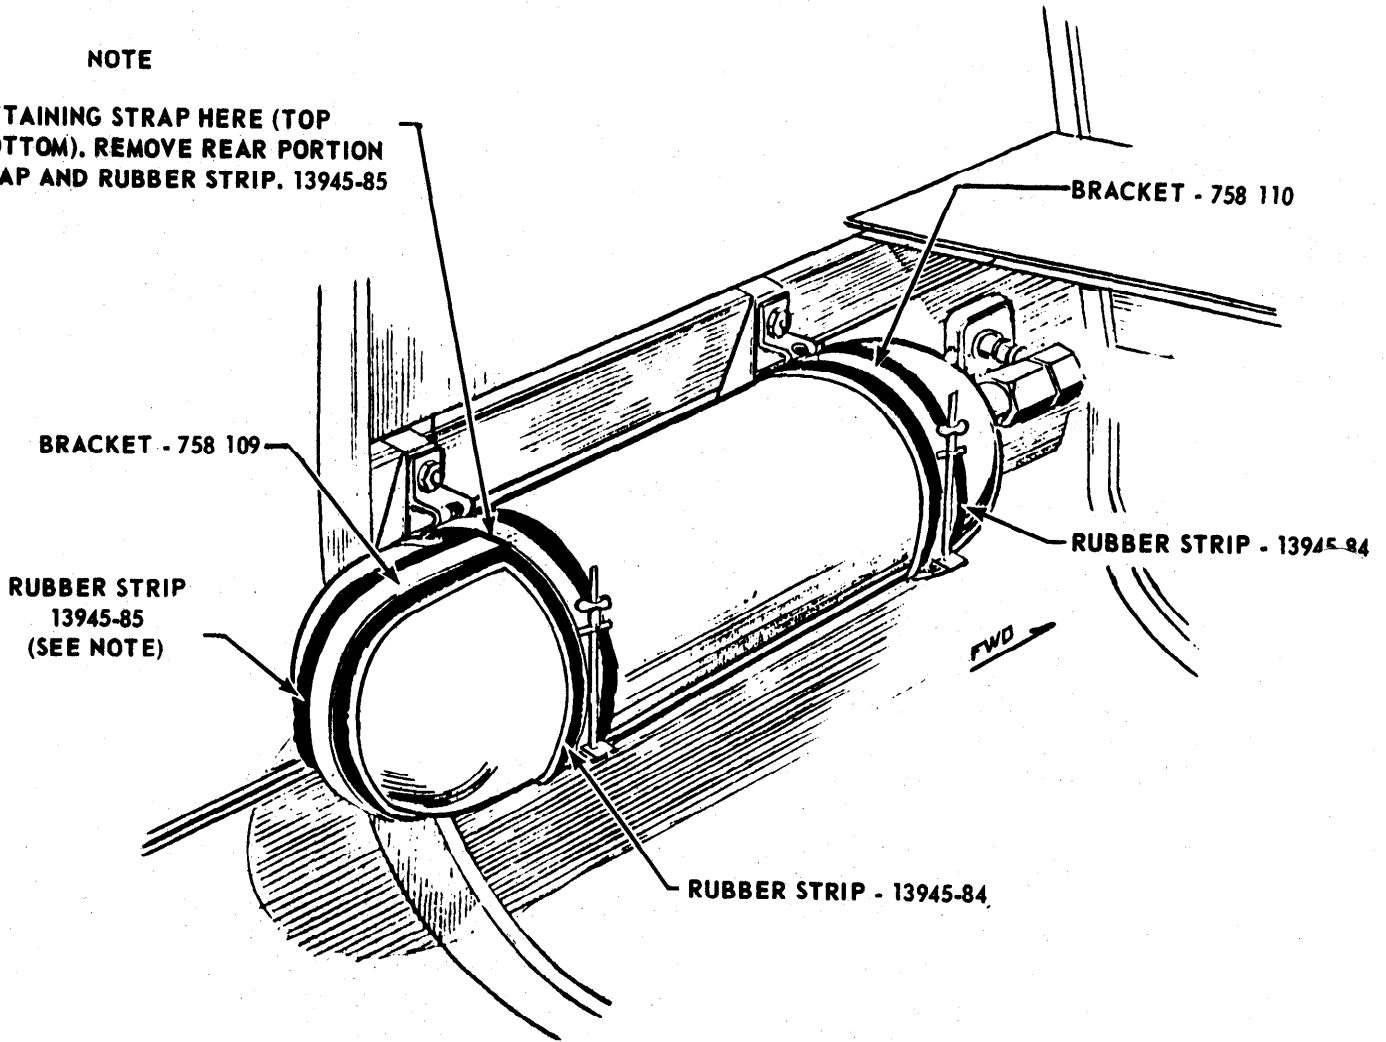

***SERVICE BULLETIN***  
***246***